

ITCU Software Release v2.7.4

Compared with v2.7.2. Release date: 2024-02-13

General

The ITCU v2.7.4 comes is a corrective release.

Versions

Software

ITCU Software Package: v2.7.3

Control Software (CTL): v2.6.0

Printer Firmware (HDB): v1.11

Application Software (ICM): v1.21.5-eriber.36627

Main Features

- None

Fixes

- Corrected Start-at-stitch problem.
Problem: Incorrect color placement after performing Start-at-stitch in an ongoing print.
Note: Problem not seen for the case when operator has stopped the print then selecting start-at-stitch (workaround for SW2.7.2).

Known limitations

MINOR:

- Open Cartridge door during maintenance procedure can make the unit become inoperable and require hard reset or need to call service technician.
 - Workaround: Ensure that cartridge door is always closed during maintenance procedure and printing (stop print before open cartridge).
- For older ITCU HW (CTL) the LED stripe is always green since it cannot be controlled in old HW.
 - Workaround: Awareness as operator.
- Currently the ITCU does not have a graceful behavior for the display during shutdown.
 - Workaround: Operator Awareness.
- Export of CSE and DST sometimes fails but is indicated as successfully. The file is created but is 0 kB in size.
 - Workaround: Re-try operation or perform action twice every time.